8189 Century Boulevard • Minneapolis, MN 55317-8002 • USA 800-843-5116 • 952-556-4900 • Fax 952-556-4997 sales@mamacsys.com • www.mamacsys.com

RoHS

Model TE-701/702 Technical Information TI.701/702-01

## DUCT TEMPERATURE SENSORS

#### For Additional Information See TE-701/702 Data Sheet

#### **SPECIFICATIONS**

**Platinum RTD Sensors:** 

±0.1% @ 32°F (0°C), Alpha: 385 per DIN 43760

Nickel RTD Sensors (#2):

±0.5°C @ 0°C (32°F), 5,000 PPM/K T.C.R.

Nickel RTD Sensors (#4):

±0.5°F @ 70°F (21.1°C), 6,000 PPM/K T.C.R.

**Balco RTD Sensors:** 

±0.5°F @ 70°F (21.1°C), 4,300 PPM/K T.C.R.

**Thermistor Sensors:** 

±0.2°C interchangeability @ 77°F (25°C)

Operating Temperature: -40°F to 210°F (-40°C to 100°C)

Ambient Temperature:

-40°F to 160°F (-40°C to 70°C)

**Probe Material:** 

1/4" (6.3 mm) O.D., 0.020" (0.5 mm) wall, 304 Stainless Steel

Flange Material:

Galvanized Steel

**Bulkhead Fitting:** 

Brass with poly compression sleeve

**Plastic Enclosure:** 

Polycarbonate 30% glass filled, rated UL 94V-5-0

Steel NEMA-1 (IP-30):

18 Ga. Galvanized Steel

Steel NEMA-4 (IP-65):

18 Ga. Cold Rolled Steel, Powder coated

Warrantv:

Five Years (Lifetime on Moisture Migration)

**EMC Conformance:** 

EN 55022, 55024, 61000-3-3, 61000-4-2, 61000-4-3, 61000-4-4, 61000-4-5, 61000-4-6 & 61000-4-11

U.S. PATENT NO. 6457857, 6555748, 7036224

### ORDERING INFORMATION: TE-701-

INSTALLATION	TEMP SENSOR	PROBE LENGTH			
A Flange mount 3" (175 mm)	100-Ohm Platinum RTD	A 4" (100 mm)			
	1,000-Ohm Nickel RTD (5,000 PPM)	B 6" (150 mm)			
B Flange mount 6' (1.8 m) plenum cable	1,000-Ohm Platinum RTD				
	1,000-Ohm Nickel RTD (6,000 PPM)	D 12" (300 mm)			
wiro loads	1,000-Ohm Balco RTD				
D Bulkhead mount 6' (1.8 m) plenum cable	10,000-Ohm NTC Thermis (Type III)	stor			
	10,000-Ohm NTC Thermis (Carel)	stor			
10	3,000-Ohm NTC Thermist	tor			
1.	2 10,000-Ohm NTC Thermis (Type II)	stor			
1	5,000-Ohm NTC Thermist	tor			
1	1,035-Ohm Silicon PTC				
1	100,000-Ohm NTC Therm	nistor			
1	20,000-Ohm NTC Thermis	stor			
1	2,252-Ohm NTC Thermist	tor			
2	1,800-Ohm NTC Thermist	tor			
Example: TE-701-B-10-A: Flange mount with 6' cable, 3K ohm thermistor and 4" probe.					

### **ORDERING INFORMATION: TE-702-**

INSTALLATION	TEMP SENSOR	PROBE LENGTH				
	1 100-Ohm Platinum RTE	A 4" (100 mm)				
	2 1,000-Ohm Nickel RTD	В <b>6" (150 mm)</b>				
B Galvanized Steel Enclosure	(5,000 PPM)	C 8" (200 mm)				
(NEMA-1 / IP-30)	3 1,000-Ohm Platinum R	D 12" (300 mm)				
C Painted Steel Enclosure (NEMA-4 / IP-65)	4 1,000-Ohm Nickel RTD (6,000 PPM)					
,	5 1,000-Ohm Balco RTD					
	7 10,000-Ohm NTC Ther (Type III)	10,000-Ohm NTC Thermistor (Type III)				
	10,000-Ohm NTC There (Carel)	10,000-Ohm NTC Thermistor (Carel)				
1	3,000-Ohm NTC Thermistor					
1	2 10,000-Ohm NTC Ther (Type II)	10,000-Ohm NTC Thermistor (Type II)				
1	5,000-Ohm NTC Thermistor					
1	4 1,035-Ohm Silicon PTC	1,035-Ohm Silicon PTC				
1	5 100,000-Ohm NTC The	ermistor				
1	7 20,000-Ohm NTC Ther	mistor				
1	2,252-Ohm NTC Therm	nistor				
2	1 1,800-Ohm NTC Therm	nistor				
Example: TE-702-A-3-D: Po	lycarb plastic enclosure with 1K ohm	Platinum RTD and 12" probe.				

## $C\epsilon$ RoHS

## DUCT TEMPERATURE SENSORS

#### INSTALLATION

#### Inspection

Inspect the package for damage. If damaged, notify the appropriate carrier immediately. If undamaged, open the package and inspect the device for obvious damage. Return damaged products.

- Requirements Tools (not provided)
  - Digital Volt-ohm Meter (DVM)

  - Appropriate screwdriver for mounting screws
     Appropriate drill and drill bit for mounting screws
  - Appropriate accessories
  - Two #8 self-tapping mounting screws (not provided)
  - Training: Installer must be a qualified, experienced technician.

#### Warning:

• Do not use on oxygen service, in an explosive/hazardous environment, or with flammable/combustible media.



- · Disconnect power supply before installation to prevent electrical shock and equipment damage.
- Make all connections in accordance with the job wiring diagram and in accordance with national and local electrical codes. Use copper conductors only.

#### Caution:

Use electrostatic discharge precautions (e.g., use of wrist straps) during installation and wiring to prevent equipment



- Avoid locations where severe shock or vibration, excessive moisture or corrosive fumes are present. NEMA-4 housings are intended for outdoor use primarily to provide a degree of protection against wind-blown dust, rain, and hose-directed
- · Do not exceed ratings of the device.

#### Mounting

Location: Install the sensor in a location where it will sample the average air temperature in a duct. Avoid areas where the air is stratified because these areas can cause sensing errors.

#### TE-701-A or B: Refer to Figure 4 for mounting dimensions.

- 1. Drill a 3/8-inch (9 mm) hole into the duct or plenum where the sensor will be installed.
- 2. Insert the sensor probe into the duct or plenum until the flange rests against the duct or plenum wall.
- 3. Use the flange as a template to mark and drill holes for two #8 self-tapping sheet metal screws (not provided).
- 4. Fasten the sensor to the duct or plenum wall with the sheet metal screws.
- 5. Make the wiring connections. Refer to Figure 1.

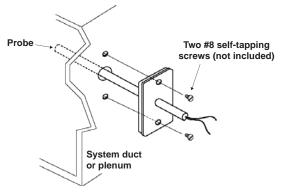


Figure 1 - Installing the TE-701-A or TE-701-B Sensor

#### TE-701-C or D: Refer to Figure 5 for mounting dimensions.

- 1. Drill a 3/8-inch (9 mm) hole into the duct or plenum where the sensor will be installed.
- 2. Remove the mounting nut from the bulkhead fitting.
- 3. Insert the sensor probe into the duct or plenum until the bulkhead fitting rests against the duct or plenum wall.
- 4. Guide the nut along the probe and tighten against the duct or plenum
- 5. Make the wiring connections. Refer to Figure 2.

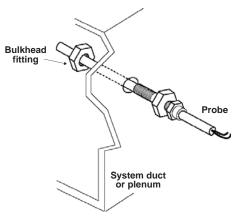


Figure 2 - Installing the TE-701-C or TE-701-D Sensor

#### TE-702-A, B, or C: Refer to Figures 6 & 7 for mounting dimensions.

- 1. Drill a 3/8-inch (9 mm) hole into the duct or plenum where the sensor will be installed.
- 2. Insert the sensor probe into the duct or plenum until the mounting bracket rests against the duct or plenum wall.
- 3. Use the mounting bracket as a template to mark and drill holes for two #8 self-tapping sheet metal screws (not provided).
- 4. Fasten the sensor to the duct or plenum wall with the sheet metal
- 5. Loosen the cover screws and rotate the cover out of the way.
- Make the wiring connections. Rotate and screw the cover back into place. Refer to Figure 3.

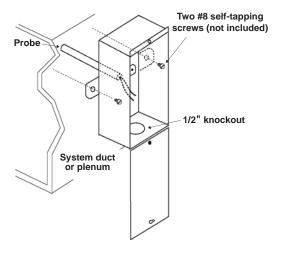


Figure 3 - Installing the TE-702-A, TE-702-B, or TE-702-C Sensor

# C€ RoHS

## **DUCT TEMPERATURE SENSORS**

#### **CHECKOUT**

Allow the sensor to stabilize in the duct air stream for a minimum of five minutes before taking a resistance measurement.

- 1. Disconnect the sensor lead wires from the controller.
- 2. Connect an ohmmeter across the lead wires.
- Ensure that nominal resistance measurements are in accordance with the resistance/temperature curves. (Refer to *Tables 1 & 2*. For complete *Resistance vs. Temperature* tables, please refer to TI.700-11 - Temperature Sensor section.)
- 4. Reconnect sensor lead wires to the controller.
- 5. Check operation of the complete control system.


**MAINTENANCE** Regular maintenance of the total system is recommended to assure sustained optimum performance.


FIELD REPAIR None. Replace with a functional unit.


#### **DIMENSIONAL DATA**

TE-701/702 Duct Temperature Sensor dimensions shown in inches and millimeters (mm).

**Figure 4** TE-701-A & TE-701-B

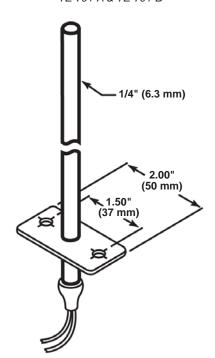

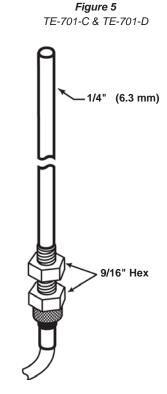

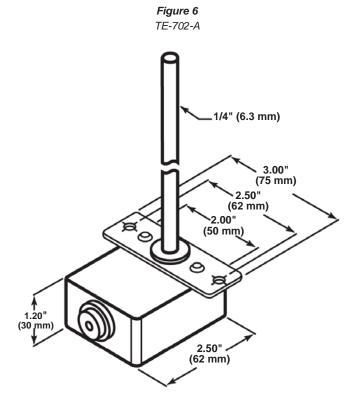

# C€ RoHS

## **DUCT TEMPERATURE SENSORS**

**Figure 7** TE-702-B & TE-702-C

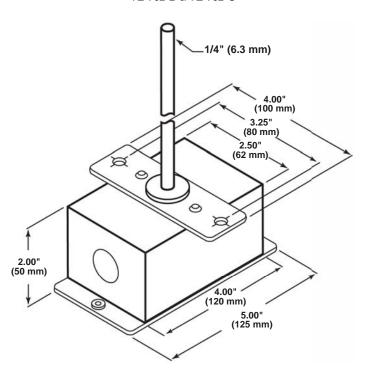


Table 1. Resistance Versus Temperature

°F	°C	Type 1 RTD	Type 3 RTD	Type 4 RTD	Type 5 RTD	Type 7 thermistor	Type 10 thermistor
72	22.2	108.66	1,086.6	1,006.0	1,004.4	11,194	3,392
72.5	22.5	108.76	1,087.6	1,007.5	1,005.5	11,068	3,350
73	22.8	108.87	1,088.7	1,009.0	1,006.6	10,943	3,309
73.5	23	108.98	1,089.8	1,010.5	1,007.6	10,820	3,269
74	23.3	109.09	1,090.9	1,012.0	1,008.7	10,698	3,229
74.5	23.6	109.19	1,091.9	1,013.5	1,009.8	10,578	3,189
75	23.9	109.30	1,093.0	1,015.1	1,011.0	10,459	3,150
75.5	24.1	109.41	1,094.1	1,016.6	1,012.1	10,343	3,112
76	24.4	109.52	1,095.2	1,018.1	1,013.2	10,227	3,074
76.5	24.7	109.62	1,096.2	1,019.6	1,014.3	10,113	3,037
77	25	109.73	1,097.3	1,021.1	1,015.4	10,000	3,000
77.5	25.3	109.84	1,098.4	1,022.6	1,016.5	9,889	2,964
78	25.5	109.95	1,099.5	1,024.1	1,017.6	9,779	2,928
78.5	25.8	110.06	1,100.1	1,025.6	1,018.7	9,671	2,890
79	26.1	110.17	1,101.7	1,027.2	1,019.8	9,563	2,858
79.5	26.4	110.27	1,102.7	1,028.7	1,020.9	9,458	2,823
80	26.7	110.38	1,103.8	1,030.2	1,022.1	9,353	2,789
80.5	27	110.49	1,104.9	1,031.7	1,023.2	9,250	2,756
81	27.2	110.60	1,106.0	1,033.3	1,024.3	9,148	2,723
81.5	27.5	110.70	1,107.0	1,034.8	1,025.4	9,045	2,690
82	27.8	110.81	1,108.1	1,036.3	1,026.5	8,943	2,658

Table 2. Resistance Versus Temperature

°F	°C	Type 12 thermistor	Type 13 thermistor	Type 15 thermistor	Type 17 thermistor	Type 18 thermistor	Type 21 thermisto
72	22.2	11,307	5,654	113,080	22,825	2,546	2,005
72.5	22.5	11,169	5,584	111,680	22,525	2,515	1,983
73	22.8	11,031	5,515	110,300	22,226	2,484	1,962
73.5	23	10,896	5,448	108,960	21,935	2,454	1,941
74	23.3	10,762	5,381	107,620	21,645	2,424	1,920
74.5	23.6	10,631	5,316	106,320	21,362	2,394	1,899
75	23.9	10,501	5,251	105,020	21,080	2,365	1,879
75.5	24.1	10,374	5,188	103,760	20,806	2,336	1,859
76	24.4	10,247	5,124	102,480	20,532	2,308	1,839
76.5	24.7	10,123	5,062	101,240	20,266	2,280	1,819
77	25	10,000	5,000	100,000	20,000	2,252	1,800
77.5	25.3	9,880	4,940	98,800	19,741	2,225	1,791
78	25.5	9,760	4,880	97,600	19,483	2,198	1,762
78.5	25.8	9,643	4,821	96,420	19,232	2,171	1,743
79	26.1	9,526	4,763	95,260	18,981	2,145	1,725
79.5	26.4	9,412	4,706	94,120	18,737	2,119	1,707
80	26.7	9,298	4,649	92,980	18,494	2,094	1,689
80.5	27	9,187	4,616	92,320	18,257	2,069	1,671
81	27.2	9,077	4,583	91,660	18,020	2,044	1,653
81.5	27.5	8,969	4,507	90,140	17,790	2,020	1,636
82	27.8	8,861	4,431	88,620	17,560	1,996	1,619

For complete *Resistance Versus Temperature* tables, please refer to TI.700-11.

For Technical / Application Assistance call your nearest office

# **MAMAC SYSTEMS**

8189 Century Boulevard • Minneapolis, MN 55317-8002 • USA 800-843-5116 • 952-556-4900 • Fax 952-556-4997 sales@mamacsys.com • www.mamacsys.com

#### **EUROPE**

Baird House, Units 6 & 7 Dudley Innovation Centre Pensnett Estate • Kingswinford West Midlands • DY6 8XZ United Kingdom 01384-271113 • Fax 01384-271114

#### ASIA

No. 22 Lorong 21A Geylang #11-02 Prosper Industrial Building Singapore • 388421 656-3927273 • Fax 656-3927276

#### AUSTRALIA

4 Arminger Court, Unit 2 Holden Hill • S.A. 5088 Australia 08-8395-4333 • Fax 08-8395-4433

#### CANADA

155 McIntosh Drive, Unit 5 Markham • Ontario • L3R 0N6 Canada 905-474-9215 • Fax 905-474-0876

MAMAC Systems, Inc., reserves the right to change any specifications without notice to improve performance, reliability, or function of our products.